

City of Albuquerque Stormwater Construction Site Inspection Report

General Information

General information								
ESC File No.	B14E0 NMR10	,		Take 5 Car Wash Coors				
		Owner			10084 Coors Blvd NW			
7/18/2024					Contractor			
Operator		Boing US Holdco, Inc.			Spinoff Construction			
Contact name & title		Jorge Primo Planta			Zane Dirkson			
e-mail		Jorge.planta@drivenbrands.com			zdirksen@Spinoffconstruction.com			
Contact Phone #		919-699-7198			623-432-6226			
COA Inspector		James Hughes			Start/End Time	: 11A	M	
Construction Phase:		verticals, concret			te/perimeter walls			
Type of Inspection:		Regular Storm Event Post Storm E			Event >0.25" 311/Complaint Follow Up			
							91	
Estimated date of last storm 0.25" or greater 7/20/2024								
Item	5.5 (6							
Number	Deficiency/ Corrective Action							
1	NOI - Take 5 C	- Take 5 Car Wash construction support activities were no longer taking place on Lot 5 of						
	Cottonwood Crossing Phase 2, except for one Portable Toilet, and the disturbed areas still weren't							
	stabilized; however, the owner of lot 5 doesn't have CGP coverage in violation of CGP 1.4, and the ESC							
	Plan and NOI for the activities on lot 5 had not been submitted to the City for approval in violation of							
	Ordinance § 14-5-2-11. Required Mitigation: You must either provide an ESC Plan and NOI per CGP 1.4							
	to the City's Storm Water Quality (SWQ) Section for approval for Gourmet Investors, LLC, the owner of							
	Lot 5 per ordinance § 14-5-2-11, or you must remove all construction support activity and stabilize the							
	disturbed portion of Lot 5 with "Native Seed and Aggregate Mulch" per City Std Spec 2012 or							
	equivalent, to comply with the Stabilization Criteria in the CGP ay Part 2.2.14							
	equivalent, to	comply with th	ne Stabilization Cr	iteria in the	CGP ay Part 2	.2.14		
_								
2						the construction s		
	activities and limits of land disturbing activities on Lot 5 were not indicated on the SWPPP Map in							
	violation of 7.2.4.b.vii. Also, recent self-inspection reports, signed by the owner/operator, were not							
	available on site in violation of Ordinance § 14-5-2-11(C)(1) and CGP 4.7.2 and Appendix G.11.2. The							
	most recent report available onsite is dated 6/1/24. Zane emailed a link to the city on 7/17/24 was							
	flagged as a security threat by the City's IT security. Zane didn't provide a PDF copy at the inspection							
	on the 18th, and the PDF of the July 1st inspection that he emailed during the inspection on 7/10/24							
	wasn't signed by the Owner/Operator. Required mitigation: You must keep the SWPPP Up-to-date per							
	CGP 7.1 including a SWPPP map of the area of construction support activities at offsite locations per							
	CGP 7.2.4.b.vii. You must keep a copy of your up-to-date SWPPP and all inspection reports at the site							
	or at an easily accessible location so that it can be made available at the time of an on-site inspection							
	per CGP Parts	4.7.3 and 7.3.						
_	•							
3			, ,	•		uction exit, had be		
	in violation of CGP Parts 2.1.4, and controls were completely missing from Lot 5. Required mitigation:							
	If at any time you find that a stormwater control needs routine maintenance, you must immediately							
	initiate the needed maintenance work and complete such work by the close of the next business day.							
	·							
	When the problem requires a new or replacement control or significant repair, install the new or							
	modified control and make it operational or complete the repair by no later than seven (7) calendar							
	days from the time of discovery per CGP 5.2.1.							
4	NATION OF THE CONTROL WAS AND							
4	Washout - The concrete washout from the previous inspection was still on the ground on 7/18/24 but							
	was being removed. During the inspection on 7/18/24, a lined roll-off container was delivered to the							
	site to contain new wash water. Wash water compliance was noted during the inspection on 7/22/24.							
	,							
			<u> </u>					
2.1	Discharge off site?	(Y/N)	yes					
4	Self Inspect	tion Reports	ok	Latest rer	oort Date:	7/1/20	24	
'	22 mopec					,, 1,20	<u> </u>	

Notes:

The SWPPP is in the Take 5 building. The Owner of lot 5 is Gourmet Investors, LLC, Ray Trombino Member at 505-480-5974 - Ray@trombinos.com. Chris Wagner at 505-550-1225 Chris@Trombinos.com is on his stormwater team. The violations on lot 5 were explained to Ray on the phone on 7/22/24, and he said he has not been contacted by anyone from the Take 5 project, nor has he ever given them any permission. Some Erosion was evident at the outfall in the northeast corner of Lot 5. The entire project drains to that outfall and sediment in the parking lot downstream of Take 5 indicated that the site had recent stormwater discharge. Mitigation was discussed again with Zane, the DA for Mr Planta. I tried to call Mr Planta but no answer. An auto-reply was received from the NOV#3 email sent to Mr. Planta saying he is out of the office and suggested sending emails for construction questions to Gabe Thompson: gabriel.thompson@drivenbrands.com and permitting questions to Sumaia Alamoudi: sumaia.alamoudi@drivenbrands.com, so it was forwarded.

 ${\bf City\ of\ Albuquerque\ Stormwater\ Inspector\ Signature\ and\ date:}$

Contact information: James Hughes (505) 924-3420

jhughes@cabq.gov

James D. Hughes

7/23/24